


## Ventilation for Welding and Cutting

### INTRODUCTION

Ventilation is used to control overexposures to the fumes and gases during welding and cutting. Adequate ventilation will keep the fumes and gases from the welder's breathing zone.

NOTE: This safety and health fact sheet does not address ventilation in confined spaces. Also, the term "welding" includes "cutting."

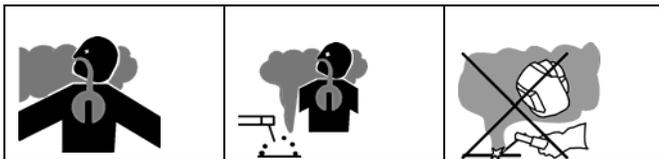

### NATURE OF THE HAZARD— THE FUME PLUME

The heat of the arc or flame creates fumes and gases (fume plume). Fumes contain respirable particles. Gases include the shielding gas, and combustion products. The heat from the arc or flame causes the fume plume to rise.

Fumes contain hazardous substances. Overexposure to them may cause acute (short term) or chronic (long term) health effects. Fumes and gases may be produced at toxic levels and they can displace oxygen in the air causing asphyxiation. Overexposure to welding fumes and gases can cause dizziness, illness, and even unconsciousness and death.

### HOW TO AVOID THE HAZARD — VENTILATION

Keep your head out of the fumes. Reposition the work, your head, or both to keep from breathing the fumes.


Use ventilation to control the fumes and gases produced from cutting and welding. Adequate ventilation keeps exposures to airborne contaminants below allowable limits. Have a technically qualified person evaluate the exposure to determine if the ventilation is adequate. Wear an approved respirator when ventilation is not adequate or practical.

Adequate ventilation depends on:

- Size and shape of the workplace
- Number and type of operations
- Contents of the fume plume
- Position of the worker's and welder's head
- Type and effectiveness of the ventilation

Adequate ventilation can be obtained through natural or mechanical means or both.

**Natural Ventilation** – is the movement of air through a workplace by natural forces. Roof vents, open doors and windows provide natural ventilation. The size and layout of the area/building can affect the amount of airflow in the welding area. Natural ventilation can be acceptable for welding operations if the contaminants are kept below the allowable limits.

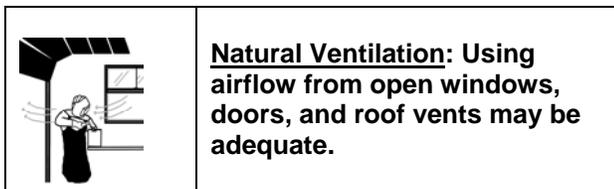


**Mechanical Ventilation** – is the movement of air through a workplace by a mechanical device such as a fan. Mechanical Ventilation is reliable. It can be more effective than natural ventilation. Local exhaust, local forced air, and general ventilation are examples of mechanical ventilation.

Local exhaust ventilation systems include a capture device, ducting and a fan. The capture devices remove fumes and gases at their source. Fixed or moveable capture devices are placed near or around the work. They can keep contaminants below allowable limits.

One or more of the following capture devices are recommended:

- Vacuum nozzle at the arc
- Fume Hoods
- Gun mounted fume extractor

Some systems filter the airflow before exhausting it. Properly filtered airflow may be recirculated.

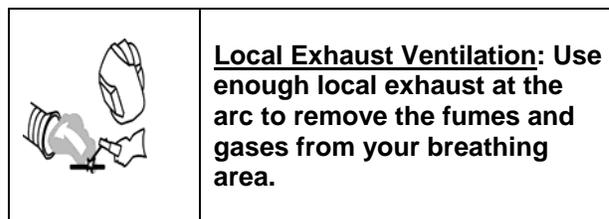

Local forced air ventilation is a local air moving system. A fan moves fresh air horizontally across the welder's face. A wall fan is an example of Local Forced Air Ventilation.

When using localized ventilation, remember:

- Locate the hood as close as possible to the work.
- Position the hood to draw the plume away from the breathing zone.
- Curtains may be used to direct airflow.
- Some toxic materials or chemicals may require increased airflows.
- Velocities above 100 feet per minute at the arc or flame may disturb the process or shielding gas.
- The capture device can depend on the type of job.

## SUMMARY

Adequate ventilation removes the fumes and gases from the welder's breathing zone and general area. It prevents overexposure to contaminants. Approved respirators may be required when ventilation is not adequate.

AWS disclaims liability for any injury to persons or to property, or other damages of any nature whatsoever, whether special, indirect, consequential or compensatory, directly or indirectly resulting from the publication, use of, or reliance on this Safety and Health Fact Sheet. AWS also makes no guaranty or warranty as to the accuracy or completeness of any information published herein.

To minimize worker overexposure to fumes and gases:

- Keep your head out of the fumes, and do not breathe the fumes.
- Reposition the work and your head to avoid the fumes.
- Choose the correct ventilation method(s) for the specific operation.
- Use enough ventilation, exhaust at the arc, or both, to keep fumes and gases from your breathing zone and the general area.
- Understand what is in the fumes.
- Have a technically qualified person sample your breathing air and make recommendations.
- Keep hazardous air contaminants below allowable limits.
- Wear the proper respirator when necessary.

## INFORMATION SOURCES

American National Standards Institute (ANSI). *Safety in Welding, Cutting, and Allied Processes* (ANSI Z49.1), published by the American Welding Society, 550 NW LeJeune Road, Miami, FL 33126; telephone 800-443-9353; web site: [www.aws.org](http://www.aws.org).

Occupational Safety and Health Administration (OSHA). *Code of Federal Regulations*, Title 29 Labor, Parts 1910.1 to 1910.1450, available from the U.S. Government Printing Office, 732 North Capitol Street NW, Washington, DC 20401; telephone: 800-321-6742; web site: [www.osha.gov](http://www.osha.gov).

National Fire Protection Association (NFPA). *Standard for Fire Prevention During Welding, Cutting, and Other Hot Work* (NFPA 51B), available from National Fire Protection Association, 1 Batterymarch Park, P.O. Box 9101, Quincy, MA 02269-9101, telephone: 800-344-3555, web site: [www.nfpa.org](http://www.nfpa.org).

American Conference of Governmental Industrial Hygienists (ACGIH), *Industrial Ventilation – A Manual of Recommended Practice* 21<sup>st</sup> edition, published by the ACGIH, 6500 Glenway Avenue, Building D-7, Cincinnati, OH 45211-4438; telephone , 513-742-2020; web site: [www.acgih.org](http://www.acgih.org).

American Welding Society (AWS). *Ventilation Guide for Weld Fume* (AWS F3.2), published by the American Welding Society, 550 NW LeJeune Road, Miami, FL 33126; telephone 800-443-9353; web site: [www.aws.org](http://www.aws.org).

Edison Welding Institute (EWI). *Reduction of Worker Exposure and Environmental Release of Welding Emissions* (NSRP report No. 43149GTH, November 30, 2003), available from the Edison Welding Institute, 1250 Arthur E. Adams Drive, Columbus, OH 43221; telephone: 614-688-5000; web site: [www.ewi.org](http://www.ewi.org).

Occupational Safety and Health Administration (OSHA). *OSHA Technical Manual (OTM)*, Section III Health Hazards, Chapter 3 Ventilation Investigation, available from OSHA, Room N3655, 200 Constitution Ave., N.W., Washington, DC 20210; telephone: 202-693-2095; web site: <http://www.osha.gov>.

---

AWS disclaims liability for any injury to persons or to property, or other damages of any nature whatsoever, whether special, indirect, consequential or compensatory, directly or indirectly resulting from the publication, use of, or reliance on this Safety and Health Fact Sheet. AWS also makes no guaranty or warranty as to the accuracy or completeness of any information published herein.